


Cleaning resistance tracks



 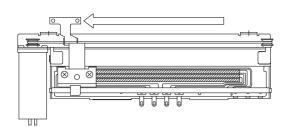


Slide the control lever to either end.

レバーを端に動かす







Soak a cotton swab with absolute ethanol without dripping.

 
綿棒に無水エタノールを染み込ませる (垂れるほどに染み込ませ過ぎない事)

3




The wiping direction is from the carrier side to the track ends, just one-way, one time per track.

可動子から端に向けて(往復はさせない)各トラック1回ずつ拭く




4

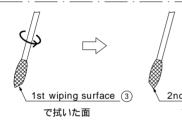

Rotate 180 degrees the cotton swab to use the clean side on next step 綿棒を180度回転させ、綺麗な面を下に向ける


2nd wipe point 5 ではこの点を当てて拭く

 5




Do the same procedure as (3) with the clean side of the cotton swab. No need to soak it with the ethanol on this step.

 と同じ作業を行う(追加でエタノールは不要)



6 Do not slide the control lever until the ethanol on the surface has dried. 抵抗面のエタノールが乾くまでレバーを動かさない



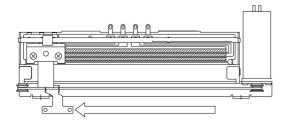

Turn upside down the fader to ease doing next steps, then slide the control lever to the other end.

作業しやすいように上下逆さまにし、 レバーを反対端に動かす

Do the same steps from (2) to (6) with a new cotton swab.

から の作業を行う